

Work Order ID 97868

March-01-13 10:35:40 AM

97868

Page 1

Item ID: D407-667-205TRN

Accept

N900040100

Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Crosstube Turning Detail

Start Date: 3/01/13 Start Qty: 1.00 ***1***

Cust Item ID:

Required Date: 3/15/13 Req'd Qty: 1.00 ***1***

Customer:

Reference:

Approvals: Process Plan: MWJ Date: 13-03-01 Tooling: _____ Date: _____ Run Start ***NR1***

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

| Sequence ID/ Work Center ID | Operation Description | Set Up/ Run Hours | Tool ID | Tool # | Plan Code | Accept Qty | Reject Qty | Reject Number | Insp. Stamp |
|--------------------------------|--------------------------|----------------------|---------|--------|--------------|---------------|---------------|------------------|----------------|
|--------------------------------|--------------------------|----------------------|---------|--------|--------------|---------------|---------------|------------------|----------------|

| Draw Nbr | Revision Nbr |
|--------------|--------------|
| D407-667-245 | Rev F |

100 0.00

100

MORI SEIKI CNC LATHE LARGE

Mori Seiki

Memo

0.00

Mori Seiki CNC Lathe Large

1-Fill tube with sand & install plugs DT8531 on both ends as per Folio FA248

2-Turn first side as per Folio FA248

3-Blend transition lines only, **do not sand whole tube**

FOLIO REV: AA

DWG REV: E

*Use mill bastard file, brush file repeatedly with file card.

*Do not use sandpaper coarser than 320 grit.

1 φ KC
13-3-21

110 0.00

110

QC1- Inspect dimensions to dimension sheet

QC

Memo

0.00

Quality Control

1 φ KC
13-3-21

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: _____ Date: _____

QA Closed: _____ Date: _____

| | | | | | | | | | | | | | | | | | | |
|--|---|---|--------------------------------------|------------------------------------|------------------------------------|--------------------------------------|------------------------------------|------------------------------------|--|----------------------------------|--|------------------------------------|--|--------------------------------|------------------------------------|------------------------------------|-----------------------------------|--|
| Work Order: _____ Part No. _____ NCR No. _____ | DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/> | AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table> | Skid-tube <input type="checkbox"/> | Crosstube <input type="checkbox"/> | Water Jet <input type="checkbox"/> | Engineering <input type="checkbox"/> | Machining <input type="checkbox"/> | Small Fab <input type="checkbox"/> | Prod. Eng. Coord. <input type="checkbox"/> | Quality <input type="checkbox"/> | Thermoforming <input type="checkbox"/> | Finishing <input type="checkbox"/> | Rec/Store/Packaging <input type="checkbox"/> | Other <input type="checkbox"/> | Large Fab <input type="checkbox"/> | Composite <input type="checkbox"/> | Supplier <input type="checkbox"/> | |
| Skid-tube <input type="checkbox"/> | Crosstube <input type="checkbox"/> | Water Jet <input type="checkbox"/> | Engineering <input type="checkbox"/> | | | | | | | | | | | | | | | |
| Machining <input type="checkbox"/> | Small Fab <input type="checkbox"/> | Prod. Eng. Coord. <input type="checkbox"/> | Quality <input type="checkbox"/> | | | | | | | | | | | | | | | |
| Thermoforming <input type="checkbox"/> | Finishing <input type="checkbox"/> | Rec/Store/Packaging <input type="checkbox"/> | Other <input type="checkbox"/> | | | | | | | | | | | | | | | |
| Large Fab <input type="checkbox"/> | Composite <input type="checkbox"/> | Supplier <input type="checkbox"/> | | | | | | | | | | | | | | | | |

| Root Cause | Date | Step | Qty | Description of work order update or Non-conformance | Initial Chief Eng | Action Description | Sign & Date | Verification | QC Inspector |
|--|------|------|-----|---|-------------------|--------------------|-------------|--------------|--------------|
| Doc/Data <input type="checkbox"/> | | | | | | | | | |
| Equip/Tooling <input type="checkbox"/> | | | | | | | | | |
| Operator <input type="checkbox"/> | | | | | | | | | |
| Material <input type="checkbox"/> | | | | | | | | | |
| Setup <input type="checkbox"/> | | | | | | | | | |
| Other <input type="checkbox"/> | | | | | | | | | |
| Process <input type="checkbox"/> | | | | | | | | | |
| Supplier <input type="checkbox"/> | | | | | | | | | |
| Training <input type="checkbox"/> | | | | | | | | | |
| Unapproved <input type="checkbox"/> | | | | | | | | | |

FAULT CATEGORY

| | | |
|---|---|--|
| Landing Gear <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube | General <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio | <input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions <input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge <input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other |
|---|---|--|

March-01-13 10:35:40 AM

Page 2

Reference:

| | | |
|-----|-------|-------|
| Run | Start | *NR1* |
| | Stop | *NR2* |

[illegible]

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: _____ Date: _____

QA Closed: _____ Date: _____

| | |
|--|--|
| Work Order: _____ Part No. _____ NCR No. _____ | DISPOSITION <div style="display: flex; justify-content: space-around;"> <div> <input type="checkbox"/> Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update </div> <div> <input type="checkbox"/> Skid-tube <input type="checkbox"/> Machining <input type="checkbox"/> Thermoforming <input type="checkbox"/> Large Fab </div> <div> <input type="checkbox"/> Crosstube <input type="checkbox"/> Small Fab <input type="checkbox"/> Finishing <input type="checkbox"/> Composite </div> <div> <input type="checkbox"/> Water Jet <input type="checkbox"/> Prod. Eng. Coord. <input type="checkbox"/> Rec/Store/Packaging <input type="checkbox"/> Supplier </div> <div> <input type="checkbox"/> Engineering <input type="checkbox"/> Quality <input type="checkbox"/> Other </div> </div> |
|--|--|

| Root Cause | Date | Step | Qty | Description of work order update or Non-conformance | Initial Chief Eng | Action Description | Sign & Date | Verification | QC Inspector |
|---------------|------|------|-----|---|-------------------|--------------------|-------------|--------------|--------------|
| Doc/Data | | | | | | | | | |
| Equip/Tooling | | | | | | | | | |
| Operator | | | | | | | | | |
| Material | | | | | | | | | |
| Setup | | | | | | | | | |
| Other | | | | | | | | | |
| Process | | | | | | | | | |
| Supplier | | | | | | | | | |
| Training | | | | | | | | | |
| Unapproved | | | | | | | | | |

FAULT CATEGORY

| | | | |
|---|---|---|---|
| Landing Gear <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube | General <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio | <input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions | <input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge <input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other |
|---|---|---|---|

Work Order ID 97868

March-01-13 10:35:40 AM

97868

Page 3

Item ID: D407-667-205TRN

Accept

N900040100Setup Start ***NS1***

Revision ID:

Item Name: Crosstube Turning Detail

Stop ***NS2***

Start Date: 3/01/13 Start Qty: 1.00

1

Cust Item ID:

Required Date: 3/15/13 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Run Start ***NR1***Stop ***NR2***

| Sequence ID/ Work Center ID | Operation Description | Set Up/ Run Hours | Tool ID | Tool # | Plan Code | Accept Qty | Reject Qty | Reject Number | Insp. Stamp |
|--------------------------------|---|----------------------|---------|--------|--------------|---------------|---------------|------------------|----------------|
| 140 | QC8- Inspect parts - second check | 0.00 | | | | | | | |
| *140* | | | | | | | | | |
| QC | Memo | 0.00 | | | | | | | JW 13-03-27 |
| Quality Control | | | | | | | | | |
| 145 | | 0.00 | | | | | | | |
| *145* | | | | | | | | | |
| Crosstubes | Memo | 0.00 | | | | | | | JW 13-03-27 |
| Crosstubes | Grind off circumferential machining marks longitudinally. | | | | | | | | |
| 150 | | 0.00 | | | | | | | |
| *150* | | | | | | | | | |
| HandFXtube | Memo | 0.00 | | | | | | | Em 13-04-15 |
| Hand Finishing Crosstubes | 1- PRESSURE WASH X-TUBE INSIDE AND OUT | | | | | | | | |
| | 2- ACID ETCH X-TUBE INSIDE AND OUT. USE RED SCOTCH BRITE | | | | | | | | |

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: _____ Date: _____

QA Closed: _____ Date: _____

| | | | | | | | | | | | | | | | | | | |
|--|---|---|--------------------------------------|------------------------------------|------------------------------------|--------------------------------------|------------------------------------|------------------------------------|--|----------------------------------|--|------------------------------------|--|--------------------------------|------------------------------------|------------------------------------|-----------------------------------|--|
| Work Order: _____ Part No. _____ NCR No. _____ | DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/> | AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table> | Skid-tube <input type="checkbox"/> | Crosstube <input type="checkbox"/> | Water Jet <input type="checkbox"/> | Engineering <input type="checkbox"/> | Machining <input type="checkbox"/> | Small Fab <input type="checkbox"/> | Prod. Eng. Coord. <input type="checkbox"/> | Quality <input type="checkbox"/> | Thermoforming <input type="checkbox"/> | Finishing <input type="checkbox"/> | Rec/Store/Packaging <input type="checkbox"/> | Other <input type="checkbox"/> | Large Fab <input type="checkbox"/> | Composite <input type="checkbox"/> | Supplier <input type="checkbox"/> | |
| Skid-tube <input type="checkbox"/> | Crosstube <input type="checkbox"/> | Water Jet <input type="checkbox"/> | Engineering <input type="checkbox"/> | | | | | | | | | | | | | | | |
| Machining <input type="checkbox"/> | Small Fab <input type="checkbox"/> | Prod. Eng. Coord. <input type="checkbox"/> | Quality <input type="checkbox"/> | | | | | | | | | | | | | | | |
| Thermoforming <input type="checkbox"/> | Finishing <input type="checkbox"/> | Rec/Store/Packaging <input type="checkbox"/> | Other <input type="checkbox"/> | | | | | | | | | | | | | | | |
| Large Fab <input type="checkbox"/> | Composite <input type="checkbox"/> | Supplier <input type="checkbox"/> | | | | | | | | | | | | | | | | |

| Root Cause | Date | Step | Qty | Description of work order update or Non-conformance | Initial Chief Eng | Action Description | Sign & Date | Verification | QC Inspector |
|--|------|------|-----|---|-------------------|--------------------|-------------|--------------|--------------|
| Doc/Data <input type="checkbox"/> | | | | | | | | | |
| Equip/Tooling <input type="checkbox"/> | | | | | | | | | |
| Operator <input type="checkbox"/> | | | | | | | | | |
| Material <input type="checkbox"/> | | | | | | | | | |
| Setup <input type="checkbox"/> | | | | | | | | | |
| Other <input type="checkbox"/> | | | | | | | | | |
| Process <input type="checkbox"/> | | | | | | | | | |
| Supplier <input type="checkbox"/> | | | | | | | | | |
| Training <input type="checkbox"/> | | | | | | | | | |
| Unapproved <input type="checkbox"/> | | | | | | | | | |

FAULT CATEGORY

| | | |
|---|---|--|
| Landing Gear <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube | General <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio | <input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions <input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge <input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other |
|---|---|--|

Work Order ID 97868

March-01-13 10:35:40 AM

97868

Page 4

Item ID: D407-667-205TRN

Accept

N900040100

Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Crosstube Turning Detail

Start Date: 3/01/13 Start Qty: 1.00

1

Cust Item ID:

Required Date: 3/15/13 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Run Start ***NR1***

Stop ***NR2***

| Sequence ID/ Work Center ID | Operation Description | Set Up/ Run Hours | Tool ID | Tool # | Plan Code | Accept Qty | Reject Qty | Reject Number | Insp. Stamp |
|--------------------------------|--------------------------|----------------------|---------|--------|--------------|---------------|---------------|------------------|----------------|
|--------------------------------|--------------------------|----------------------|---------|--------|--------------|---------------|---------------|------------------|----------------|

160 QC5- Inspect part completeness to step on W/O

0.00

160

QC

Memo

0.00

SW7
13418

1

Quality Control

170

0.00

170

Packaging

Packaging

Memo

0.00

Packaging

Identify and stock in kanban rackLocation:

LG

RM 13-04-18

180

0.00

180

QC21- Final Inspection - Work Order Release

QC

Memo

0.00

Quality Control

13/4/22

13-04-18

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: _____ Date: _____

QA Closed: _____ Date: _____

| | | |
|--|---|--|
| Work Order: _____ Part No. _____ NCR No. _____ | DISPOSITION <div style="display: flex; justify-content: space-around;"> <div>Rework <input type="checkbox"/></div> <div>Skid-tube <input type="checkbox"/></div> <div>Crosstube <input type="checkbox"/></div> <div>Water Jet <input type="checkbox"/></div> <div>Engineering <input type="checkbox"/></div> </div> <div style="display: flex; justify-content: space-around;"> <div>Scrap <input type="checkbox"/></div> <div>Machining <input type="checkbox"/></div> <div>Small Fab <input type="checkbox"/></div> <div>Prod. Eng. Coord. <input type="checkbox"/></div> <div>Quality <input type="checkbox"/></div> </div> <div style="display: flex; justify-content: space-around;"> <div>Use-as-is <input type="checkbox"/></div> <div>Thermoforming <input type="checkbox"/></div> <div>Finishing <input type="checkbox"/></div> <div>Rec/Store/Packaging <input type="checkbox"/></div> <div>Other <input type="checkbox"/></div> </div> <div style="display: flex; justify-content: space-around;"> <div>Work Order Update <input type="checkbox"/></div> <div>Large Fab <input type="checkbox"/></div> <div>Composite <input type="checkbox"/></div> <div>Supplier <input type="checkbox"/></div> </div> | |
|--|---|--|

| Root Cause | Date | Step | Qty | Description of work order update or Non-conformance | Initial Chief Eng | Action Description | Sign & Date | Verification | QC Inspector |
|---------------|------|------|-----|---|-------------------|--------------------|-------------|--------------|--------------|
| Doc/Data | | | | | | | | | |
| Equip/Tooling | | | | | | | | | |
| Operator | | | | | | | | | |
| Material | | | | | | | | | |
| Setup | | | | | | | | | |
| Other | | | | | | | | | |
| Process | | | | | | | | | |
| Supplier | | | | | | | | | |
| Training | | | | | | | | | |
| Unapproved | | | | | | | | | |

FAULT CATEGORY

| | | | |
|---|---|---|---|
| Landing Gear <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube | General <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio | <input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions | <input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge <input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other |
|---|---|---|---|

Picklist Print

March-01-13 10:35:44 AM

Page 1

Work Order ID: 97868

97868

Parent Item: D407-667-205TRN

D407-667-205TRN

Parent Item Name: Crosstube Turning Detail

Start Date: 3/01/13

Required Date: 3/15/13

Start Qty: 1.00

Required Qty: 1.00

Comments: IPP Rev:A 08-03-06 new issue DD verified by:ec
 IPP Rev B 08.04.02 Removed polish EC verified by: DD
 IPP Rev:C 08-08-19 revE as per dwg DD verified by:EC

| Component Item ID/ Item Name | Replacement Item ID | Mfg/ Purch | Bin Item | Primary Location | Last Location | Route Seq ID | Unit of Measure | Qty on Hand | Qty per Kit | Total Qty | Qty Issued | Date Issued | Status |
|---------------------------------|------------------------|---------------|-------------|---------------------|------------------|-----------------|--------------------|----------------|-------------|--------------|---------------|----------------|--------|
|---------------------------------|------------------------|---------------|-------------|---------------------|------------------|-----------------|--------------------|----------------|-------------|--------------|---------------|----------------|--------|

D6011-115

Manufactured

No

120

Each

23.0000

1

1

D6011-115

**

Crosstube Material

Location

Loc Qty

Loc Code

LG015

23

67798

12

69802

11

KE

13-3-21

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: _____ Date: _____

QA Closed: _____ Date: _____

| | | | | | | | | | | | | | | | | | | |
|--|---|---|--------------------------------------|------------------------------------|------------------------------------|--------------------------------------|------------------------------------|------------------------------------|--|----------------------------------|--|------------------------------------|--|--------------------------------|------------------------------------|------------------------------------|-----------------------------------|--|
| Work Order: _____ Part No. _____ NCR No. _____ | DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/> | AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table> | Skid-tube <input type="checkbox"/> | Crosstube <input type="checkbox"/> | Water Jet <input type="checkbox"/> | Engineering <input type="checkbox"/> | Machining <input type="checkbox"/> | Small Fab <input type="checkbox"/> | Prod. Eng. Coord. <input type="checkbox"/> | Quality <input type="checkbox"/> | Thermoforming <input type="checkbox"/> | Finishing <input type="checkbox"/> | Rec/Store/Packaging <input type="checkbox"/> | Other <input type="checkbox"/> | Large Fab <input type="checkbox"/> | Composite <input type="checkbox"/> | Supplier <input type="checkbox"/> | |
| Skid-tube <input type="checkbox"/> | Crosstube <input type="checkbox"/> | Water Jet <input type="checkbox"/> | Engineering <input type="checkbox"/> | | | | | | | | | | | | | | | |
| Machining <input type="checkbox"/> | Small Fab <input type="checkbox"/> | Prod. Eng. Coord. <input type="checkbox"/> | Quality <input type="checkbox"/> | | | | | | | | | | | | | | | |
| Thermoforming <input type="checkbox"/> | Finishing <input type="checkbox"/> | Rec/Store/Packaging <input type="checkbox"/> | Other <input type="checkbox"/> | | | | | | | | | | | | | | | |
| Large Fab <input type="checkbox"/> | Composite <input type="checkbox"/> | Supplier <input type="checkbox"/> | | | | | | | | | | | | | | | | |

| Root Cause | Date | Step | Qty | Description of work order update or Non-conformance | Initial Chief Eng | Action Description | Sign & Date | Verification | QC Inspector |
|---------------|------|------|-----|---|-------------------|--------------------|-------------|--------------|--------------|
| Doc/Data | | | | | | | | | |
| Equip/Tooling | | | | | | | | | |
| Operator | | | | | | | | | |
| Material | | | | | | | | | |
| Setup | | | | | | | | | |
| Other | | | | | | | | | |
| Process | | | | | | | | | |
| Supplier | | | | | | | | | |
| Training | | | | | | | | | |
| Unapproved | | | | | | | | | |

FAULT CATEGORY

| Landing Gear | General | Other | Other |
|---|---|--|---|
| <input type="checkbox"/> Bending | <input type="checkbox"/> Bend | <input type="checkbox"/> Grain | <input type="checkbox"/> Ovalized |
| <input type="checkbox"/> Centre Not Concentric to O/S | <input type="checkbox"/> BOM/Route | <input type="checkbox"/> Hardware | <input type="checkbox"/> Over/Under tolerance |
| <input type="checkbox"/> Cracks | <input type="checkbox"/> Broken/Damaged | <input type="checkbox"/> Inspection Incomplete | <input type="checkbox"/> Part Incorrect |
| <input type="checkbox"/> Crushed/Crimped | <input type="checkbox"/> Burrs | <input type="checkbox"/> Instructions Incomplete/Unclear | <input type="checkbox"/> Part Lost/Missing |
| <input type="checkbox"/> Cuffs | <input type="checkbox"/> Contamination | <input type="checkbox"/> Maintenance | <input type="checkbox"/> Part Moved |
| <input type="checkbox"/> Heat Treat | <input type="checkbox"/> Countersink | <input type="checkbox"/> Mislabeled | <input type="checkbox"/> Positioned Wrong |
| <input type="checkbox"/> Inspection Strip in Tube | <input type="checkbox"/> Cut Too Short | <input type="checkbox"/> Misread | <input type="checkbox"/> Power Loss/Surge |
| <input type="checkbox"/> Ripples in Bend | <input type="checkbox"/> Drill Holes | <input type="checkbox"/> Offset | <input type="checkbox"/> Other |
| <input type="checkbox"/> Torque Waves in Extrusion | <input type="checkbox"/> Drawing | <input type="checkbox"/> Out of Calibration | |
| <input type="checkbox"/> Turning Sequence | <input type="checkbox"/> Finish | <input type="checkbox"/> Out of Sequence | |
| <input type="checkbox"/> Wave/Twist in Tube | <input type="checkbox"/> Folio | <input type="checkbox"/> Outside Dimensions | |


| | | |
|---|--|----------------------------------|
| DART AEROSPACE LTD | | Work Order: 97868 |
| Description: Crosstube Assembly | | Part Number: D407-667-245 |
| Inspection Dwg: D407-667-245 Rev: F | | Page 1 of 2 |

FIRST ARTICLE INSPECTION CHECKLIST

| | Inspection Sheet Drawing Dimension | Tolerance | Actual Dimension | Accept | Reject | Method of Inspection | Comments |
|--------|---------------------------------------|---------------|---------------------|--------|--------|-------------------------|----------|
| SIDE A | 2.490 | +0.005/-0.000 | 2.494 | ✓ | | VERN | CNC-08 |
| | 1.832 | +0.005/-0.000 | 1.834 | ✓ | | ↓ | ↓ |
| | 1.838 | +0.005/-0.000 | 1.842 | ✓ | | ↓ | ↓ |
| | 1.892 | +0.005/-0.000 | 1.894 | ✓ | | ↓ | ↓ |
| | 2.052 | +0.005/-0.000 | 2.055 | ✓ | | MIC | CNC-04 |
| | 2.206 | +0.005/-0.000 | 2.209 | ✓ | | ↓ | ↓ |
| | 2.521 | +0.005/-0.000 | 2.524 | ✓ | | ↓ | ↓ |
| | 2.633 | +0.005/-0.000 | 2.635 | ✓ | | ↓ | ↓ |
| | 4.10 | +/-0.030 | 4.10 | ✓ | | VERN | CNC-08 |
| | 4.978 | +/-0.030 | 4.979 | ✓ | | ↓ | ↓ |
| | 2.040 | +0.000/-0.010 | 2.031 | ✓ | | ↓ | ↓ |
| | 0.125 | +/-0.010 | .125 | ✓ | | ↓ | ↓ |
| | R0.063 | +/-0.010 | .063 | ✓ | | — | — |
| | R0.500 | +/-0.010 | .500 | ✓ | | — | — |
| | 2.490 | +0.005/-0.000 | 2.494 | ✓ | | VERN | CNC-08 |
| | 1.832 | +0.005/-0.000 | 1.834 | ✓ | | | |
| SIDE B | 1.838 | +0.005/-0.000 | 1.841 | ✓ | | | |
| | 1.892 | +0.005/-0.000 | 1.893 | ✓ | | | |
| | 2.052 | +0.005/-0.000 | 2.055 | ✓ | | MIC | CNC-04 |
| | 2.206 | +0.005/-0.000 | 2.208 | ✓ | | ↓ | ↓ |
| | 2.521 | +0.005/-0.000 | 2.524 | ✓ | | ↓ | ↓ |
| | 2.633 | +0.005/-0.000 | 2.635 | ✓ | | ↓ | ↓ |
| | 4.10 | +/-0.030 | 4.10 | ✓ | | VERN | CNC-08 |
| | 4.978 | +/-0.030 | 4.980 | ✓ | | ↓ | ↓ |
| | 2.040 | +0.000/-0.010 | 2.032 | ✓ | | ↓ | ↓ |
| | 0.125 | +/-0.010 | .125 | ✓ | | ↓ | ↓ |
| | R0.063 | +/-0.010 | .063 | ✓ | | — | — |
| | R0.500 | +/-0.010 | .500 | ✓ | | — | — |
| | 112.91 | +/-0.020 | 112.91 | ✓ | | TAPE | LG-15 |

| | |
|---|----------------------------------|
| DART AEROSPACE LTD | Work Order: 97868 |
| Description: Crosstube Assembly | Part Number: D407-667-245 |
| Inspection Dwg: D407-667-245 Rev: F | Page 2 of 2 |

WALL THICKNESS MEASUREMENT

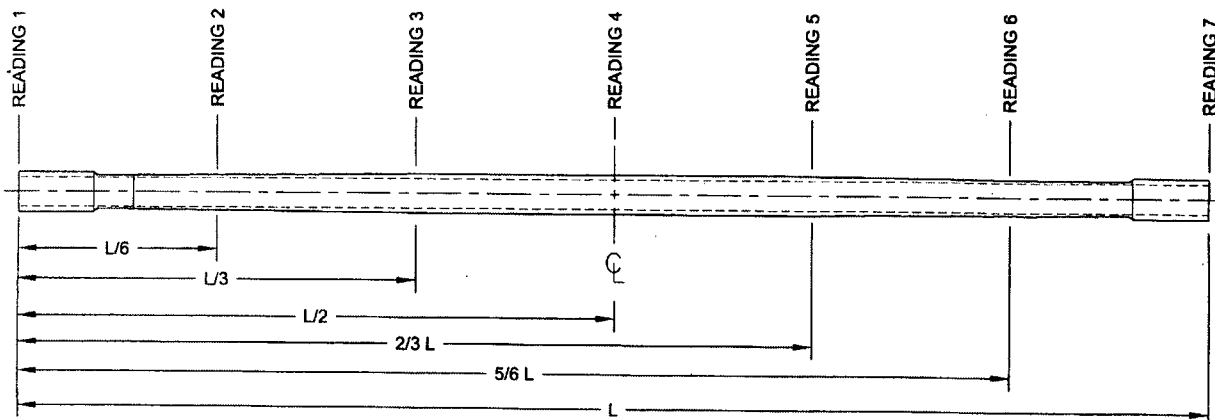

| Location | WALL THICKNESS MEASUREMENT (IN) | | | | Deviation Δw (max-min) | TOLERANCE |
|-------------------------|---------------------------------|------|------|------|--------------------------------------|-----------|
| | w1 | w2 | w3 | w4 | | |
| READING 1 L = 0" | .235 | .234 | .235 | .246 | .006 | 0.075" |
| READING 2 L = 17 | .227 | .220 | .233 | .238 | .018 | |
| READING 3 L = 36 | .388 | .393 | .395 | .393 | .007 | |
| READING 4 L = 56 | .656 | .666 | .653 | .651 | .009 | |
| READING 5 L = 36 | .406 | .391 | .378 | .393 | .020 | |
| READING 6 L = 17 | .235 | .223 | .220 | .233 | .015 | |
| READING 7 L = cutoff | .235 | .233 | .237 | .236 | .004 | |

Calibration Result

Actual Block Thickness: .160 .250

SITESCAN 250 Measured Thickness: .160 .250

| | | |
|--------------------------|-----------------------|------------------------------|
| Measured by: mm.l | Audited by: JW | Preliminary Approval: |
| Date: 13/03/22 | Date: 13-03-27 | Date: |

| Rev | Date | Change | Revised by | Approved |
|-----|----------|---------------------------------------|------------|----------|
| A | 04.04.21 | New Issue (P/O D407-667-205) | KJ/RF | |
| B | 06.03.09 | Dwg Rev updated | KJ/JLM | |
| C | 06.03.30 | Tolerance revised for 4.978 dimension | KJ/JLM | |
| D | 07.02.19 | Dwg Rev updated | KJ/JLM | |
| E | 09.05.20 | Dwg Rev updated | KJ | |
| F | 12.06.04 | Wall thickness form added | KJ | |

| Item | QTY -245 | PART NUMBER | DESCRIPTION |
|------|-------------|----------------|--|
| 1 | X | D407-667-245 | CROSSTUBE ASSEMBLY (407 HIGH AFT) |
| 2 | 1 | D6011-115 | CROSSTUBE |
| 3 | 2 | D2856-400-773 | ABRASION STRIP |
| 4 | 2 | D2873-043 | NUT PLATE |
| 5 | 2 | D2873-045 | NUT PLATE |
| 6 | 1 | D2894-1 | SUPPORT |
| 7 | 2 | D3190-1 | CHAFING SHIELD |
| 8 | 2 | D3595-063-430 | RUBBER CUSHION |
| 9 | 14 | MS20601AD4W8 | RIVET (OR NAS9302B-4-8) |
| 10 | 4 | MS21920-22 | CLAMP |
| 11 | 2 | MS21920-25 | CLAMP (OR MS21920-24) |
| 12 | A/R | MAGNOBOND 6398 | ROCKWELL SPECIFICATION RBO-120-023 ADHESIVE (TEXTRON/BELL SPEC. 299-947- 100, TYPE II, CLASS 2 ADHESIVE) |

GENERAL NOTES:

- 1) MATERIAL: MANUFACTURED FROM D6011-115
FINISHED LENGTH = 112.91±0.020
- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
PAINT OUTSIDE PER DART QSI 005 4.2
- 3) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED.
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX.
- 6) IDENTIFICATION: SCRIBE DART PART NUMBER "D407-667-245" AND BATCH NUMBER ON INSIDE OF CUFF USING VIBRATING STYLUS.
- 7) WEIGHT: 27.7 lbs
- 8) PART IS SYMMETRIC ABOUT CENTERLINE.
- 9) RUN-OFF PART. BLEND OUT EDGE LONGITUDINALLY. TRANSITION SHOULD BE SMOOTH.
- 10) BEND PROGRESSIVELY WITH A MINIMUM OF 6 PASSES. MAXIMUM TUBE FLATTENING DUE TO BENDING IS 6% BASED ON O.D.
- 11) LIQUID PENETRANT INSPECT OUTSIDE SURFACE OF CROSSTUBE PER QSI 038.
- 12) INSTALL D2894-1 CENTER SUPPORT USING A 0.03" TO 0.06" THICK LAYER OF MAGNOBOND 6398 PER QSI 015. LET CURE FOR 12 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.
- 13) INSTALL MS21920-25 CLAMPS WITH D3595-063-430 RUBBER CUSHIONS TO SECURE D2894-1 SUPPORT ON TOP SIDE OF THE CROSSTUBE. ENSURE CLAMPS ARE OPPOSITE CROSSTUBE SUPPORT.
NOTE: MS21920-24 CLAMPS CAN BE USED TO ACCOMMODATE VARYING DIAMETERS. ENSURE THERE IS A MINIMUM OF 1.5 THREADS IN SAFETY ON THE NUTS.
- 14) EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE.
- 15) INSTALL D2856-400-773 ABRASION STRIP WITH A 0.13 (REF) GAP ON BOTTOM SIDE OF CROSSTUBE, PER QSI 035.
- 16) INSTALL D3190-1 CHAFING SHIELDS SO THAT OVERLAP IS ON BOTTOM SIDE OF CROSSTUBE OPPOSITE D2894-1 SUPPORT.
- 17) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS ARE SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING.

100% COPY
 RETURN TO
 ENGINEERING
 CONTROLLED COPY
 FOR EXAMINMENT
 FOR WORK
 97868 MLS






13-03-01

2 DEO ATTACHED

RELEASED
08/11/12

| | | | |
|------------|---|--|--------------|
| F | REFORMAT NOTES TO NEW STANDARDS (ZN B8-1); RELOCATED FLAG # 6 (ZN A8-3) PER NCR 210; REMOVED REF. & ADD TOLERANCES (ZN C6-3, C4-3 & D2-3) | RF | 08.11.06 |
| E | 8.02 AND 8.53 WERE 8.40 AND 8.90 (ZN D5-2); REORGANIZED VIEWS AND REFORMATED DRAWING TO CURRENT STANDARDS. REASONS: CLAMPS MOVED 0.375 TOWARD CL TO ELIMINATE INTERFERENCE WITH AIRCRAFT MOUNTS. REFERENCE: FAR#08-21 AND ECR#1225 | MB | 08.07.24 |
| D | ADD VIEW FOR OEM SKID HOLES, ROTATE ORIENTATION OF CLAMPS SECTION F-F, REMOVE -851 ABRASION STRIP, ADD MAGNOBOND 6398, ADD CUSHION | PH | 07.02.07 |
| C | ADD HOLES AND NUT PLATES FOR COMPATIBILITY WITH BHT/AA SKIDTUBES | PH | 05.07.26 |
| B | ADD CHAFING SHIELD | CP | 03.05.21 |
| A | NEW ISSUE | CP | 02.05.13 |
| REV. | DESCRIPTION | BY | DATE |
| DESIGN | RF | DART AEROSPACE LTD HAWKESSBURY, ONTARIO, CANADA | |
| DRAWN | RF | | |
| CHECKED | RF | DRAWING NO. | REV. F |
| MFG. APPR. | RF | D407-667-245 | SHEET 1 OF 4 |
| APPROVED | RF | TITLE | SCALE |
| DE APPR. | RF | CROSSTUBE ASS'Y (407 HIGH AFT) | NTS |
| DATE | 08.11.06 | COPYRIGHT © 2012 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR REPRODUCED IN ANY FORM OR BY ANY MEANS WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD. | |


97868

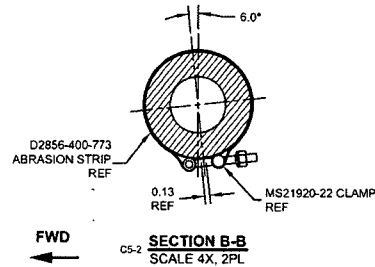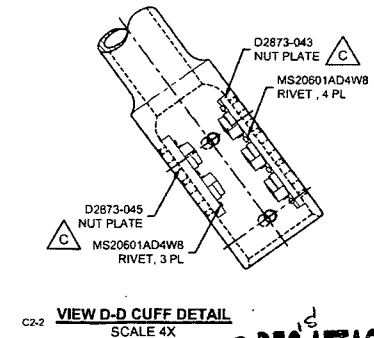
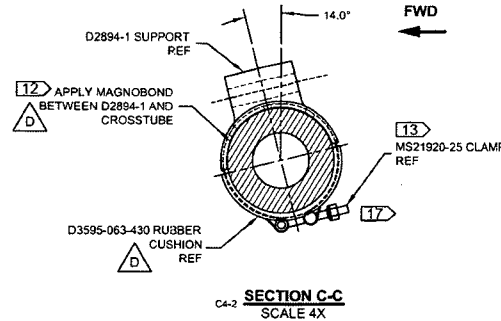
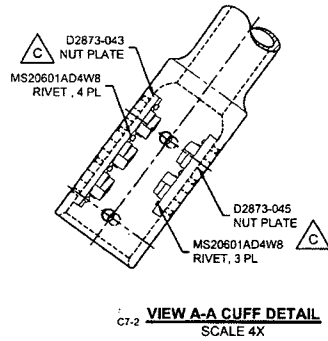
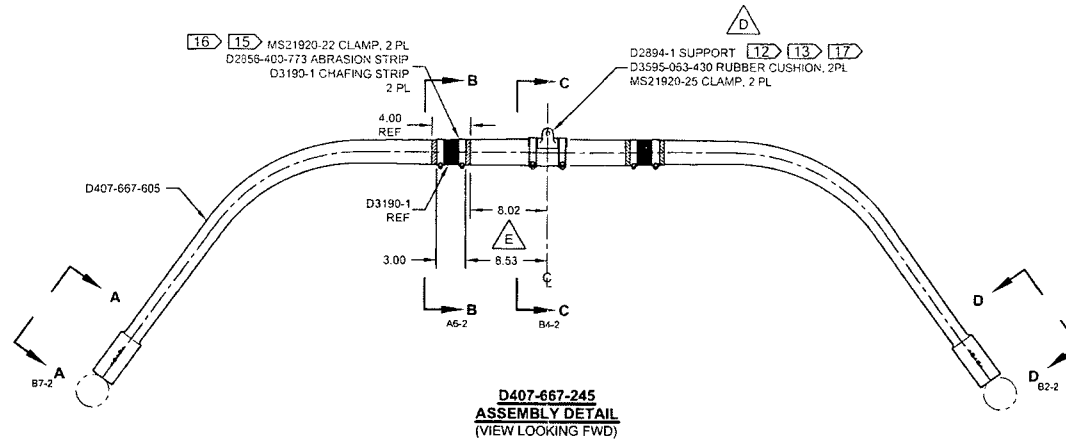


DEO ATTACHED
RELEASED
08/11/06

| | | | |
|------------|----------|--|--------------|
| DESIGN | 47 | DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA | |
| DRAWN | RF | DRAWING NO. | REV. F |
| CHECKED | 47 | D407-667-245 | SHEET 2 OF 4 |
| MFG. APPR. | 47 | TITLE | SCALE |
| APPROVED | 47 | CROSSTUBE ASS'Y (407 HIGH AFT) | NTS |
| DE APPR. | 47 | COPYRIGHT © 2003 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD. | |
| DATE | 08.11.06 | | |

97868

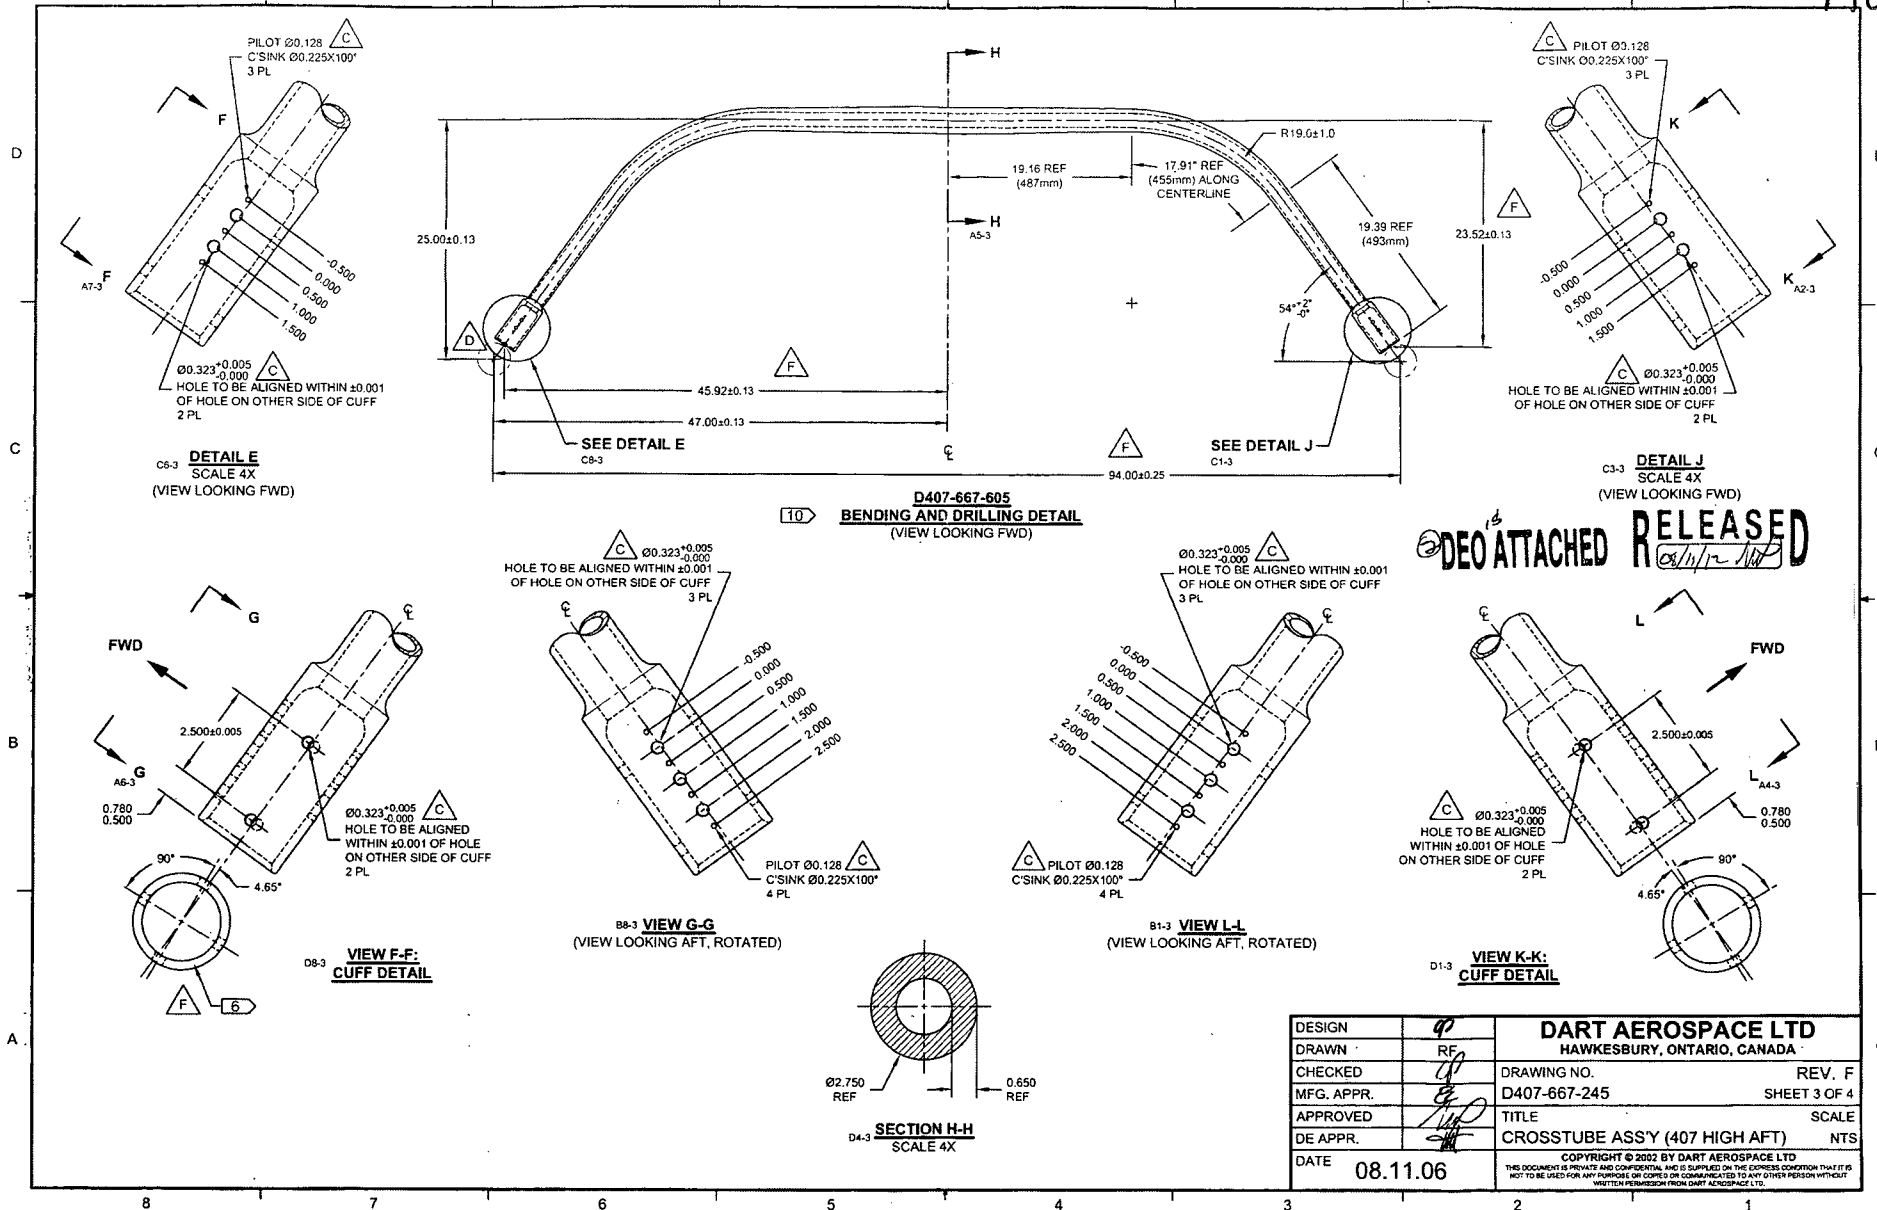

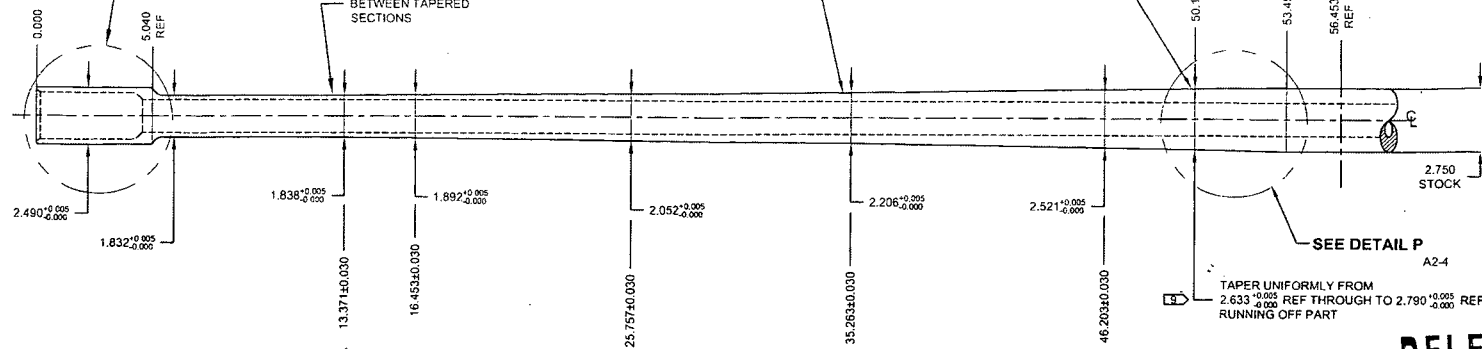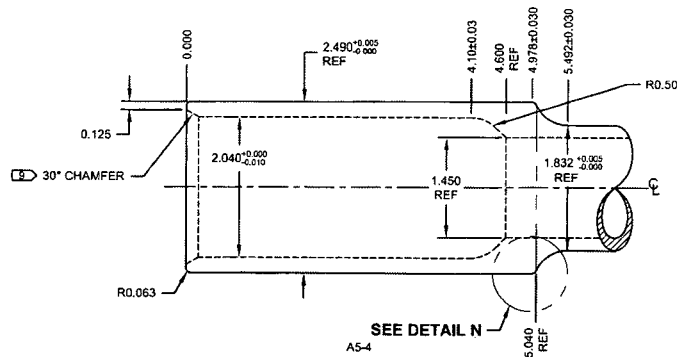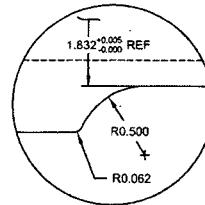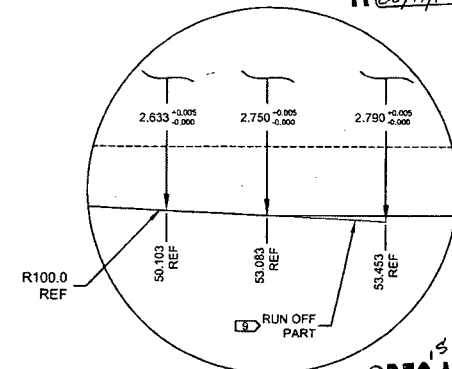SEE DETAIL M
A7-4**D407-667-245 MACHINING DETAIL**
DETAIL M: CROSSTUBE CUFF
 SCALE 3X

DETAIL N: CUFF TRANSITION
 SCALE 2X

DETAIL P: TAPER RUN-OFF
 NOT TO SCALE

RELEASED
 08/11/12 JWB

DEO ATTACHED

| | | | |
|------------|----------|--|--------------|
| DESIGN | 97 | DART AEROSPACE LTD | |
| DRAWN | RF | HAWKESBURY, ONTARIO, CANADA | |
| CHECKED | 47 | DRAWING NO. | REV. F |
| MFG. APPR. | 47 | D407-667-245 | SHEET 4 OF 4 |
| APPROVED | 47 | TITLE | SCALE |
| DE APPR. | 47 | CROSSTUBE ASS'Y (407 HIGH AFT) | NTS |
| DATE | 08.11.06 | COPYRIGHT © 2003 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD. | |

97868

| | | | | | | | |
|-----------------------------|--|---------------------------|---|-------------------------|--------------------------------|---------------------------|--------------|
| DRAWING NO. D407-667-245 | TITLE CROSSTUBE ASSY (407 HIGH AFT) | REV. F | DART AEROSPACE LTD ENGINEERING ORDER | | D.E.O. NO. D407-667-245-F-1 | SHEET NO. SHEET 1 OF 2 | SCALE NTS |
| DRAWN [Signature] | CHECKED [Signature] | MFG. APPR. [Signature] | APPROVED [Signature] | DE APPR. [Signature] | | | |
| DATE 11.04.08 | DATE 11.04.12 | DATE 11.04.12 | DATE 11.04.12 | DATE 11.04.12 | | | |

PURPOSE:

REMOVED ABRASION STRIP IN FAVOR OF A THIN LAYER OF PROSEAL 890.

CHANGE:

PARTS LIST IS AMENDED AS FOLLOWS:

IS:

| Item | Qty -245 | Part Number | Description |
|------|-------------|---------------|----------------|
| 3 | 0 | D2856-400-773 | ABRASION STRIP |

WAS:

| | | | |
|---|---|---------------|----------------|
| 3 | 2 | D2856-400-773 | ABRASION STRIP |
|---|---|---------------|----------------|

NOTES 2 AND 15, SHEET 1 ARE AMENDED AS FOLLOWS:

IS:

- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
MASK UNDERSIDE OF CROSSTUBE AS SHOWN (HATCHED AREA) AND
PAINT OUTSIDE PER DART QSI 005 4.2
REMOVE MASKING AND APPLY CLEAR COAT
- 15) APPLY A THIN COAT OF PROSEAL 890 ON INSIDE CONCAVE SURFACE OF D3190-1
CHAFING SHIELDS AND LET CURE PER MANUFACTURER'S INSTRUCTIONS. INSTALL
PROSEALED D3190-1 CHAFING SHIELDS ONTO CROSSTUBE BY APPLYING A THIN COAT
OF PROSEAL 890 ONTO CROSSTUBE. BE SURE TO ELIMINATE ANY AIR GAPS.

WAS:

- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
PAINT OUTSIDE PER DART QSI 005 4.2
- 15) INSTALL D2856-400-773 ABRASION STRIP WITH A 0.13 REF GAP ON BOTTOM SIDE OF
CROSSTUBE PER QSI 035.

RELEASED
2011-04-18
[Signature]


97868

| | | | | | | |
|-----------------------------|--|---------------------|---|--------------------------------|---------------------------|--------------|
| DRAWING NO. D407-667-245 | TITLE CROSSTUBE ASSY (407 HIGH AFT) | REV. F | DART AEROSPACE LTD ENGINEERING ORDER | D.E.O. NO. D407-667-245-F-1 | SHEET NO. SHEET 2 OF 2 | SCALE NTS |
| DRAWN | CHECKED <i>UP</i> | MFG. APPR. <i>E</i> | APPROVED <i>WP</i> | DE APPR. <i>H</i> | | |
| DATE 11.04.08 | DATE 11.04.11 | DATE 11.04.12 | DATE 11/04/12 | DATE 11.04.12 | | |

IS:

WAS:

RELEASED
2011-04-18

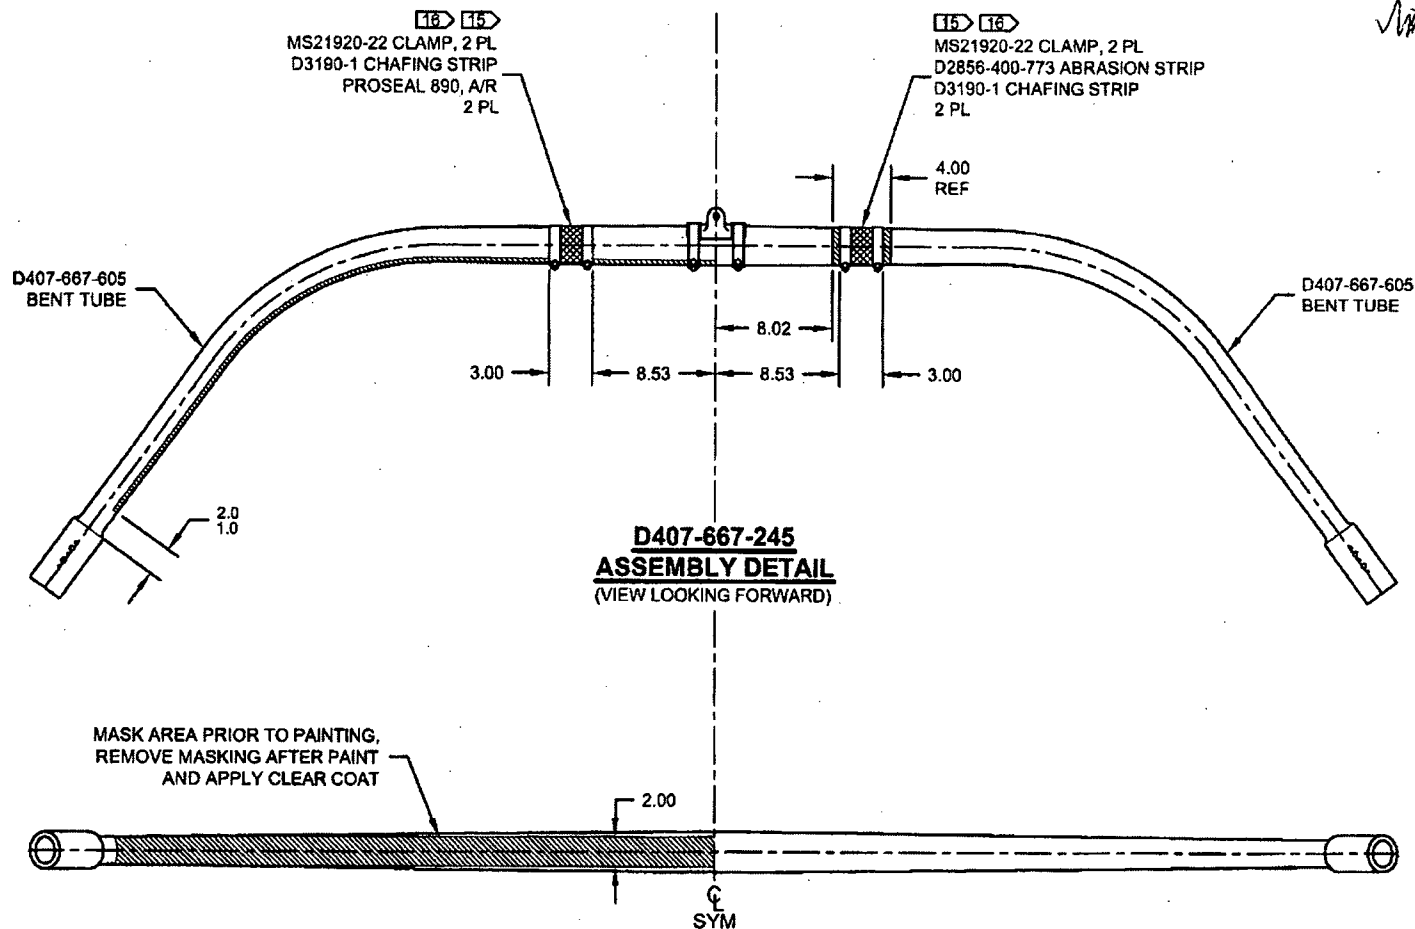

COPYRIGHT © 2011 BY DART AEROSPACE LTD
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS
NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT
WRITTEN PERMISSION FROM DART AEROSPACE LTD.

97868

| | | | | | | | |
|-----------------------------|---|------------------|---|--|--------------------------------|---------------------------|--------------|
| DRAWING NO. D407-667-245 | TITLE CROSSTUBE ASS'Y (407 HIGH AFT) | REV. F | DART AEROSPACE LTD ENGINEERING ORDER | | D.E.O. NO. D407-667-245-F-2 | SHEET NO. SHEET 1 OF 1 | SCALE NTS |
| DRAWN 97 | CHECKED ASS | MFG. APPR. E | APPROVED MP | | DE APPR. th | | |
| DATE 11.09.07 | DATE 11.09.15 | DATE 11.09.19 | DATE 11.09.19 | | DATE 11.09.19 | | |

PURPOSE:

REPLACE MAGNOBOND WITH 3M DP460 SCOTCH-WELD EPOXY ADHESIVE

CHANGE:

IS:

| Item | Qty -245 | Part Number | Description |
|------|-------------|-------------------|--------------------------------|
| 12 | A/R | SCOTCH-WELD DP460 | EPOXY ADHESIVE, 3M SCOTCH-WELD |

WAS:

| | | | |
|----|-----|----------------|---|
| 12 | A/R | MAGNOBOND 6398 | ROCKWELL SPECIFICATION RBO-120-023 ADHESIVE (TEXTRON/BELL SPEC. 299-947-100, TYPE II, CLASS 2 ADHESIVE) |
|----|-----|----------------|---|

NOTE 12 & 17, SHEET 1 IS AMENDED AS FOLLOWS:

IS:

- 12) INSTALL D2894-1 CENTER SUPPORT USING A 0.04" TO 0.07" THICK LAYER OF SCOTCH-WELD DP460 PER QSI 015. LET CURE FOR 24 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.
- 15) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING. PRIOR TO PACKAGING, RE-CHECK TORQUE ON CLAMPS AFTER ADHESIVE HAS CURED FOR 24 HOURS.

WAS:

- 12) INSTALL D2894-1 CENTER SUPPORT USING A 0.03" TO 0.06" THICK LAYER OF MAGNOBOND 6398 PER QSI 015. LET CURE FOR 12 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.
- 15) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS ARE SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING.

RELEASED
2011-09-29
MD

